

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE, CONNAUGHT PLACE

NEW DELHI- 110001


No. F.6/DFS/MS/EH/2026/SZ/ 128

Dated: 11/02/2026

FIRE SAFETY CERTIFICATE

Certified that the M/s Chili's Restaurant (A unit of Trimex Foods Pvt. Ltd.) located at Shop No. 319, 3rd Floor, Vegas Mall, Plot No. 6, Sector- 14, Dwarka New Delhi- 110078, running at third floor of Vegas Mall building comprised of 04 basement, ground plus 05 upper floors, was issued FSC by this department vide letter No. F.6/DFS/MS/SZ/2023/EH/24 dated 19.01.2023. The eating house building was re-inspected by the officer concerned of this department on dated 04.01.2026 in the presence of the Mr. Abhishak, and found that the restaurant have deemed complied with the fire prevention and fire safety requirements in accordance with Rule 33 of the Delhi Fire Service Rules, 2010 and that the restaurant building/premises (Restaurant at third floor only) is fit for occupancy class Group "D" Assembly Building" w.e.f. 11/02/2026 for a period of three years, in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule-38 of the Delhi Fire Service Rules, 2010 printed below.

Issued on 11/02/2026 at New Delhi.


(A.K. Malik)
Dy. Chief Fire Officer
South Zone

Online application Id 2026011400474 dated 15.01.2026.

Copy to: - The Executive Engineer (Building), MCD, Civic Centre, Minto Road, New Delhi. :- to inform about use of basement and a request to ensure the occupancy as detailed above and deviation, if any.

Conditions for validity of Fire Safety Certificate:-

1. The FSC issued only for eating house/ restaurant running at third floor only.
2. All the fire safety arrangements provided therein shall be maintained in good working condition at all times.
3. The means of escape shall be kept unlocked and unobstructed for unhindered evacuation of occupants in case of emergency.
4. Any loss of life or property due to non-functional fire safety measures shall be at the risk and responsibility of the management.
5. The trained staff should be available round the clock.
6. Any deviations w.r.t. construction shall be verified by the concerned building sanctioning agency.
7. The basement shall be used as per the building bye laws.
8. The certificate may not be treated in any case for the regularization of the unauthorized construction, if any.
9. The owner/occupier shall submit a declaration every year in the form 'K' provided in the first schedule of Delhi Fire Service Rules 2010, form is available on www.dfs.delhigovt.nic.in.
10. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in the Form 'J' [sub rule (1) of rule 37] along with a copy of this Certificate, six months prior to its expiry.

INSPECTION REPORT

- N/18
1. Name & address of the building : M/s. Chillis Restaurant (A unit of Trmex Foods Pvt. Ltd.) located at Shop No. 319, 3rd floor of Vegas Mall Plot No. 6, Sector- 14, Dwarka, New Delhi.
 2. Type of Occupancy : Assembly (Restaurant)
 3. Building is comprised of : 04 basement, ground plus five upper floors
 4. Type of Case : Renewal (Eating House) **Restaurant running at 3rd floor only**
 5. Details of Previous FSC : F.6/DFS/MS/SZ/2023/EH/24 dated 03.01.2023
 6. Fire Safety directives letter No : F.6/DFS/MS/BP/2016/326 dated 16.12.2016 (issued to Mall)
 7. Date of inspection : 04.02.2026
 8. Name of Inspecting Officers : R.K. Yadav, ADO (DWK)
 9. Name and designation of officers
From the building side : Mr. Abhishak
 10. Year of Construction : 2019
 11. Applicant's letter No. : MHA Portal ID 2026011400474 dated 15.01.2026

Sr. No.	Minimum Standards on fire prevention and fire safety U/R 33	UBBL/NBC- 2016 Requirement	Provided at site	Remarks MR/NMR
1.	Access to building	Same as Vegas Mall		
	<ul style="list-style-type: none"> • Road width • Gate width • Width of internal road 	12.0 m 6.0 m 6.0 m	Provided Provided Provided	MR MR MR
2.	Number, Width, Type & Arrangement of Exits	(common with mall)		
	a. Number of staircases	Restaurant running at 3rd floor only		
	<ul style="list-style-type: none"> • Upper Floors • Basements 	02 nos. N/A	Provided by Mall 12 Provided by Mall	MR N/A
	b. Width of staircases			
	<ul style="list-style-type: none"> • Upper Floor • Basements 	1.5 m N/A	Provided by Mall Provided by Mall	MR N/A
	c. Protection of exits			
	<ul style="list-style-type: none"> • Fire check door • Pressurization 	N/A N/A	N/A N/A	N/A N/A
	d. No. of continuous staircases to terrace	N/A	N/A	N/A
	e. Width of Corridor	N/A	N/A	N/A
	f. Door Size	1.5 m (02 nos.)	2.0 m & 1.5 m	MR
3.	Compartmentation	Common with Mall		
	<ul style="list-style-type: none"> • Fire check door • Sealing of electrical shafts • Fire Rating of shaft door • Water Curtain • Fire Dampers 	Required Required Required Required Required	Provided by Mall Provided by Mall Provided by Mall Provided by Mall Provided by Mall	MR MR MR MR MR
4.	Smoke Management System			
	<ul style="list-style-type: none"> • Basements • Upper floors 	N/A 12 ACPH	N/A Provided by Mall	N/A MR
5.	Fire Extinguishers			
	<ul style="list-style-type: none"> • Total numbers in restaurant • Types • ISI marking 	08 no.'s (03) ABC/CO ₂ ISI marked	Provided ABC- 03 & Co2- 03 Provided	M/R M/R M/R
6.	First-Aid Hose Reels	Provided & Maintain by Mall		
	<ul style="list-style-type: none"> • Total numbers at each floor • Length of hose reel hose • Nozzle diameter 	Required 36 m 5 mm	Provided by mall Provided Provided	M/R M/R M/R
7.	Automatic fire detection and alarming system in restaurant			

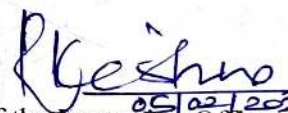
	<ul style="list-style-type: none"> Type of detectors Smoke/Heat Location of Main Panel Location of Repeater Panel Alternate source of power Hooters' Location 	Smoke/Heat Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
		Required	Provided	MR
8.	MOEFA	Required	Provided	M/R
9.	Public Address System	Required	Provided by Mall	MR
10.	Automatic Sprinkler System	Common with Mall		
	<ul style="list-style-type: none"> Basement 	Required	Provided by mall	MR
	<ul style="list-style-type: none"> Upper floors 	Required	Provided by mall	MR
	<ul style="list-style-type: none"> Sprinkler above false ceiling 	Required	Provided by mall	MR
11.	Internal Hydrants	Provided & Maintain by Mall		
	<ul style="list-style-type: none"> Size of riser/down-comer 	150 mm	Provided	M/R
	<ul style="list-style-type: none"> Number of hydrants 	01 no's for restaurant	03 Provided by Mall	M/R
	<ul style="list-style-type: none"> Hose Box 	Required	Provided	M/R
12.	Yard Hydrants	Provided & Maintain by Mall		
	<ul style="list-style-type: none"> Total number of hydrants 	N/A	Provided	N/A
	<ul style="list-style-type: none"> Hose Box 	N/A	Provided	N/A
13.	Pumping Arrangements	Provided & Maintain by Mall		
	<ul style="list-style-type: none"> Ground Level 			
	<ul style="list-style-type: none"> ➤ Discharge of main Pump 	N/A	2850 LPM	N/A
	<ul style="list-style-type: none"> ➤ Head of Main pump 	N/A	88mts	N/A
	<ul style="list-style-type: none"> ➤ Number of main pumps 	N/A	02	N/A
	<ul style="list-style-type: none"> ➤ Jockey Pump out put 	N/A	280 LPM	N/A
	<ul style="list-style-type: none"> ➤ Jockey pump head 	N/A	88 mts	N/A
	<ul style="list-style-type: none"> ➤ Standby Pump out put 	N/A	2850 LPM	N/A
	<ul style="list-style-type: none"> ➤ Standby Pump Head 	N/A	88mts	N/A
	<ul style="list-style-type: none"> ➤ Auto Starting/Manual Stopping 	N/A	Provided	N/A
	<ul style="list-style-type: none"> ➤ Pump House Access 	N/A	Provided	N/A
	<ul style="list-style-type: none"> Terrace level 			
	<ul style="list-style-type: none"> ➤ Discharge of pump 	900 LPM	Provided by mall	MR
	<ul style="list-style-type: none"> ➤ Head of the pump 	40 m	Provided by mall	MR
	<ul style="list-style-type: none"> ➤ Power Supply 	Required	Provided by mall	MR
	<ul style="list-style-type: none"> ➤ Auto Starting of pump 	Required	Provided by mall	MR
14.	Captive Water Storage for fire-fighting	Provided & Maintain by Mall		
	<ul style="list-style-type: none"> ➤ Underground tank capacity 	N/A	4,00,000 lts	N/A
	<ul style="list-style-type: none"> ➤ Draw-off connection 	N/A	Provided	N/A
	<ul style="list-style-type: none"> ➤ Fire service inlet 	N/A	Provided	MR
	<ul style="list-style-type: none"> ➤ Access to tank 	N/A	Provided	N/A
	<ul style="list-style-type: none"> Overhead Tank capacity 	20,000 ltrs	Provided	MR
15.	Exit Signage.	Required	Provided	M/R
16.	Provision of Lifts	Common with Mall		
	<ul style="list-style-type: none"> Pressurization of Lift Shaft 	N/A	Provided by mall	N/A
	<ul style="list-style-type: none"> Pressurization of Lift lobby 	N/A	Provided by mall	N/A
	<ul style="list-style-type: none"> Communication In lift Car 	N/A	Provided by mall	N/A
	<ul style="list-style-type: none"> Fireman's Grounding Switch 	N/A	Provided by mall	N/A
	<ul style="list-style-type: none"> Lift Signage 	N/A	Provided by mall	N/A
17.	Standby power supply	Required	Provided by Mall	M/R
18.	Refuge Area.			
	<ul style="list-style-type: none"> ➤ Total Area 	N/A	Provided	N/A
	<ul style="list-style-type: none"> ➤ Location 	N/A	N/A	N/A

MR	Fire Control Room			
MR	• Detector System Panel	N/A	Provided by mall	N/A
M	• Flow Switch Panel	N/A	Provided by mall	N/A
	• PA System Panel	N/A	Provided by mall	N/A
	• Battery backup	N/A	Provided by mall	N/A
	• Building Floor Plans	N/A	Provided by mall	N/A
20.	Special Fire Protection System for Protection of special Risks, if any:	N/A	Provided by Mall	N/A

The fire protection systems provided in the building were tested, checked and found functional at the time of inspection. The shortcomings was issued by this department vide letter No. F6/DFS/MS/EH/NDZ/2026/44 dated 14.01.2026 have been rectified.

Note: - The FSC in respect of Vegas Mall building is already issued vide letter No. F.6/DFS/MS/SZ/2025/HTL/32 dated 16.12.2025. The restaurant running at 3rd Floor of Vegas Mall building.

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules the FSC issued vide letter No. F.6/DFS/MS/SZ/2023/EH/24 dated 19.01.2023, **renewal under rule 37** of the Delhi Fire Service Rules 2010, **is recommended.**


 Signature of the Inspecting Officer
 Name: - R.K. Yadav
 Designation: - ADO (DWK)

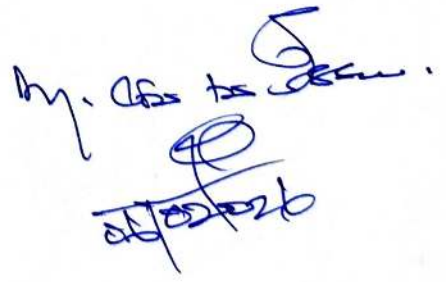

 6/2/26

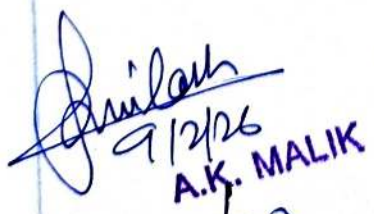
RAJINDER ATWAL
 DFO (S2)



 6/2/26
 A.K. MALIK

Principal Director


 Dy. CEO (S2)


 Dy. CEO to Secy.


 9/2/26
 A.K. MALIK

DO (S2) 
 9/2
 ADO - Dwk