



No. 6/DFS/MS/EH/SZ/2026/ 216

Dated: 13/03/2026

**FIRE SAFETY CERTIFICATE**

Certified that the M/s **CHILIS GRILL N BAR** Trimex Foods Previte Limited located at R 308, 3<sup>rd</sup> floor, Ambience Mall, Plot No. 2, Nelson Mandela Marg, New Delhi – 110070 in a building comprised of Two-tier basements, ground plus three upper floors, owned/occupied by Trimex Foods Previte Limited was issued FSC vide letter No. F6/DFS/MS/EH/2021/SZ/106 dated 20/03/2023. The premises was re-inspected by the officer concerned of this department on 03/03/2026 in presence of Mr. Aman (Manager) and found that the said premises have deemed complied with the fire prevention and fire safety requirements in the accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the building is fit for occupancy class **Group - D “Assembly Building” (Restaurant running at 3<sup>rd</sup> floor only)** with effect from 13/03/2026 for a period of **three years** in accordance with rule 36 unless renewal under rule 37 or sooner cancelled under rule 40 and subject to compliance of the conditions under rule 38 of the DFS rule 2010, printed below.

Issued on 13/03/2026 at New Delhi by.

  
(A.K. Malik)  
Dy. Chief Fire Officer  
Delhi Fire Service  
etc (W)

**Copy to: -**

1. The Dy. Health Officer, Public Health Department, South Zone, Green Park, Delhi - 110016. Online application ID No. 2026022602083 dated 26/02/2026.
2. The Manager, **CHILIS GRILL N BAR** Trimex Foods Previte Limited located at R 308, 3<sup>rd</sup> floor, Ambience Mall, Plot No. 2, Nelson Mandela Marg, New Delhi – 110070.

**Conditions for the validity of Fire Safety Certificate**

1. The owner /occupier shall apply for renewal of this fire safety certificate to the Director in form J' [sub rule (1) of rule 37] along with a copy of this certificate, six months prior to its expiry
2. All the means of escape shall be kept free of all the type of obstruction all the time.
3. All the employees shall be acquainted with the use and maintenance of all fire equipment's and method of smooth and speedy safe evacuation of occupants in case of emergency.
4. All the firefighting equipment's shall be maintained in perfect working condition all the time and any lapse rendering non-functional of fire safety measures, management shall be responsible.
5. The clarification with regards electrical installation, ventilation, structure stability set back areas, occupancy and constructional deviation in building etc. may be got verified from the authorities concerned.
6. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
7. This Fire Safety Certificate cannot be treated in any case for regularizations of unauthorized construction unauthorized use of land if any.
8. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rule 2010. The form is available on [www.dfs.delhigovt.nic.in](http://www.dfs.delhigovt.nic.in).

N/17

## INSPECTION REPORT

1	Name & address of the building	M/s Chillis Grill N Bar Trimex Foods Previte Limited located at R 308, 3 <sup>rd</sup> floor, Ambience Mall, Plot No. 2, Nelson Mandela Marg, New Delhi - 110070.			
2	Building is comprised of	Two tier Basements, ground plus three upper floors			
3	Type of occupancy	Assembly Building Group - D (Restaurant)			
4	Type of case	Renewal Case			
5	Details of previous FSC	F6/DFS/MS/EH/2021/SZ/106 dated 20/03/2023			
6	Fire safety directives letter no.	Nil			
7	Date of inspection	03/03/2026			
8	Name of the inspecting officers	Yashwant Singh Meena, ADO / Mathura Road			
9	Name of the designation of officer from the building side	Mr. Aman (Manager)			
10	Year of construction	2008	Restaurant running at 3 <sup>rd</sup> floor, Ambience Mall building.		
11	Applicant's letter no.	MHA Application ID No. 2026022602083 dated 26/02/2026			
S. No	Minimum standard of fire prevention and fire safety U/R 33	NBC / UBBL Requirement/	Provided at site	Remarks MR/NMR	
1.	<b>Access to Building:</b> FSC No. Application ID 5202610700132 dated 02/02/2026 of Ambience Mall				
	A	Road width	Restaurant within Mall	As above	MR
	B	Gate width		As above	N/A
	C	Width of internal road		As above	N/A
2.	<b>Number, Width, Type and Arrangement of Exits:</b>				
	A	Number of staircases	<b>Provided &amp; Maintained by Ambience Mall</b>		
	a	Upper floor	02 nos.	As above	MR
	b	Basement	N/A	As above	MR
	B	Width of staircases	<b>Provided &amp; Maintained by Ambience Mall</b>		
	a	Upper floor	1.5 m	As above	MR
	b	Basement	N/A	As above	N/A
	C	Protection of exits	<b>Provided &amp; Maintained by Ambience Mall</b>		
	a	Fire check door	Required	As above	MR
	b	Pressurization	Required	As above	MR
	D	No. of continuous staircases to terrace	Required	As above	MR
	E	Width of corridor	N/A	N/A	N/A
	F	Door size	Required	1.50 meters & 1.17 meter	MR (Old Case)
3.	<b>Compartmentation:</b> Provided & Maintained by Ambience Mall				
	A	Fire check door	Required	As above	MR
	B	Sealing of electrical shafts	Required	As above	MR
	C	Fire rating of shaft door	N/A	N/A	N/A
	D	Water curtain	N/A	N/A	N/A
	E	Fire dampers	N/A	N/A	N/A
4.	<b>Smoke Management System:</b> Provided & Maintained by Ambience Mall				
	A	Basement	N/A	As above	N/A
	B	Upper floor	Required	Exhaust fans provided	MR

(w)

<b>5. Fire Extinguisher:</b>				
A	Total numbers	06 nos.  ISI Marked	06 nos.	MR
B	Types		ABC-04, CO <sub>2</sub> -02	MR
C	ISI marking		Provided	MR
<b>6 First-Aid-Hose Reel: Provided &amp; Maintained by Ambience Mall</b>				
A	Total numbers of each floor	Hose Reel	One in Restaurant	MR
B	Length of hose reel hose		30 meters.	MR
C	Nozzle diameter		05 mm	MR
<b>7 Automatic Fire Detection and Alarming System: Provided &amp; Maintained by Ambience Mall</b>				
A	Type of detectors	Required	Smoke/Heat	MR
B	Location of main panel	Required	As above	MR
C	Location of repeater panel	N/A	N/A	N/A
D	Alternate source of power	Required	As above	MR
E	Hooter's Location	Required	As above	MR
<b>8 MOEFA: Required As above MR</b>				
<b>9 Public Address System: Required As above MR</b>				
<b>10 Automatic Sprinkler System: Provided &amp; Maintained by Ambience Mall</b>				
A	Basement	Required	As above	MR
B	Upper floor	Required	Provided in rest.	MR
C	Sprinkler above false ceiling	Required	As above	MR
<b>11 Internal Hydrants: Provided &amp; Maintained by Ambience Mall</b>				
A	Size of riser/down-comer	Required	As above	MR
B	Number of hydrants per floor	Required	As above	MR
C	Hose box	Required	As above	MR
<b>12 Yard Hydrants:</b>				
A	Total number of hydrants	N/A	As above	N/A
B	Hose box	N/A	As above	N/A
<b>13 Pumping Arrangements: Provided &amp; Maintained by Ambience Mall</b>				
<b>1 Ground level</b>				
A	Discharge of main pump	4500 LPM	As above	MR
B	Head of main pump	70 mtrs.	As above	MR
C	Number of main pumps	02 nos.	As above	MR
D	Jockey pump out put	450 LPM	As above	MR
E	Jockey pump head	70 mtrs.	As above	MR
F	Standby pump out put	4500 LPM	As above	MR
G	Standby pump head	70 mtr	As above	MR
H	Auto starting /manual stopping	Required	As above	MR
<b>2 Terrace Level Provided &amp; Maintained by Ambience Mall</b>				
A	Discharge of pump each block	450 LPM	As above	MR
B	Head of the pump	40 m	As above	MR
C	Power supply	Required	As above	MR
D	Auto starting of pump	Required	As above	MR

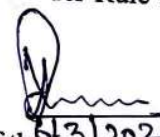
n/119

<b>14</b>	<b>Captive Water Storage for Fire Fighting: Provided &amp; Maintained by Ambience Mall</b>			
A	Underground tank capacity	5,00,000 liters	As above	MR
B	Draw-off connection	Required	As above	MR
C	Fire service inlet	Required	As above	MR
D	Access to tank	Required	As above	MR
E	Overhead tank capacity	20,000 liters	As above	MR
<b>15</b>	<b>Exit Signage:</b>			
		Required	Provided	MR
<b>16</b>	<b>Provision of Lifts: Provided &amp; Maintained by Ambience Mall</b>			
A	Pressurization of lift shaft	N/A	As above	N/A
B	Pressurization of lift lobby	N/A	As above	N/A
C	Communication in lift car	N/A	As above	N/A
D	Firemen's grounding switch	N/A	As above	N/A
E	Lift signage	N/A	As above	N/A
<b>17</b>	<b>Standby Power Supply:</b>			
		Required	Provided (DG Set)	MR
<b>18</b>	<b>Refuge Area:</b>			
A	Total area	N/A	N/A	N/A
B	Location	N/A	N/A	N/A
<b>19</b>	<b>Fire Control Room: Provided &amp; Maintained by Ambience Mall</b>			
A	Detector system panel	N/A	As above	N/A
B	Flow switch panel	N/A	As above	N/A
C	PA system panel	N/A	As above	N/A
D	Battery backup	N/A	As above	N/A
E	Building floor plans	N/A	As above	N/A
<b>20</b>	<b>Special Fire Protection systems for protection of special Risks, if any:</b>			
				N/A

The fire protection system was randomly checked and tested and was found functional at the time of inspection.

Keeping in view of the substantial compliance of the minimum standards on fire prevention and fire safety measures as required under the rules, the Fire Safety Certificate issued vide letter No. F6/DFS/MS/EH/2021/SZ/106 dated 20/03/2023, renewal under Rule 37 of the Delhi Fire Service rules 2010, is recommended to be renewed.

last disposal date of the case is 27.03.2026

  
 Signature of the Inspecting Officer  
 Name: Yashwant Singh Meena  
 Designation: ADO/Mathura Road

D.O/SD

  
 6/3/26

Dy. Secy

  
 10/3/26  
**A. K. MALIK**  
 Principal Director

  
 10/3/26  
**A.K. MALIK**

my. cf to Gen.  
  
 10/03/26