

C/188

**GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI  
HEAD QUARTERS, DELHI FIRE SERVICE, NEW DELHI -110001**

No.F6/DFS/MS/NDZ/2025/196

Dated 23/04/2025

**FIRE SAFETY CERTIFICATE**

Certified that the Emergency Block at Dr. R.M.L. Hospital, New Delhi, comprised of Ground + 05 Upper floors owned/occupied by Dr. RML Hospital, was earlier granted FSC by this department vide letter No.F6/DFS/MS/Hospital/2015/NDZ/157 dated 03/02/15. Now, the premises was re-inspected by the officer concerned of this department on 07/04/25 in the presence of Mr. N.K Jiaswal JE (E) & Mr Goverdhan AE ( E ) and found that the said building has deemed complied with the fire prevention and fire safety requirements in accordance with rule 33 of the Delhi Fire Service Rules, 2010 and that the premises is fit for occupancy class Group -C Institutional ( Hospital ) with effect from 23/04/2025... for period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules 2010, printed below.

Issued 23/04/2025... at New Delhi by.

  
(Atul Garg)  
DIRECTOR  
Delhi Fire Service  
96 224

Copy to:-

1. The Chief Architect, NDMC, Palika Kendra, New Delhi.
2. Dr. (Prof.) Ajay Shukla Director & Medical Superintendent, R.M.L. Hospital, Baba Kharag Singh Marg, New Delhi.
3. Executive Engineer (E), Dr. RML Hospital, Elect. Division, CPWD New Delhi - 110001.

**Conditions for the validity of Fire Safety Certificate**

1. All the fire safety arrangements provided therein shall be maintained in good working conditions at all times.
2. Any loss of life or property due to non functional fire safety measures shall be at the responsibility of the management.
3. The trained fire fighting staff should be available round the clock.
4. The compliance with regards to electrical installation, structural stability, set back area, occupancy and any deviation in construction etc. shall be verified from authority concerned.
5. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
6. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
7. The means of escape shall be kept unobstructed / unlocked for unhindered evacuation in case of an emergency.
8. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (I) of rule 37] along with a copy of this Certificate, six month prior to its expiry.
9. Pending work as submitted by hospital authority vide letter no. 12-04/2025/RMLH/MS/112 dated 22.04.2025 placed on file regarding completion of compliance of installation of fire curtain at lift lobby , repairing of fire check door, pressurization system at staircase and lift lobby, clearing of 06 meter road for fire tender movement in one side, shall be completed within 03 month under intimation to this department, otherwise this FSC shall stand null & void automatically.

2/31

**INSPECTION REPORT**

1. Name & address of the building : Emergency Block at Dr. R.M.L. Hospital, New Delhi.
2. Type of occupancy : Hospital Building (Gr. + 05 Upper floors)
3. Type of case:- : Renewal
4. Details of previous FSC : F6/DFS/MS/Hospital/2015/NDZ/157 dated 03/02/15.
5. Fire safety directives No. : N/A
6. Date of inspection:- : 21/04/25
7. Name of the inspecting officer : Sh. Ravinder Singh ADO/CC  
Sh. Rajinder Atwal, DO ( CD)
8. Name & designation of officer  
From the building side : Sh. Mohit (JE), Sh. Omprakash (AE)
9. Year of construction : 2010
10. Applicant's letter No : letter no. 12-04-2025/RMLH/MS/71 dated 15.04.2025

Old Case

S.No.	Minimum Standards on fire Prevention and fire safety U/R 33	Requirement/ Existing	Provided at site	Remarks MR/NMR
1.	Access to Building			
	1) Road width	13 mtr.	16 mtr.	MR
	2) Gate width	05 mtr.	05 mtr.	MR
	3) Width of internal road	06 mtr.	06 mtr	MR*
2.	Number, Width Type & Arrangement of Exits			
	A. Number of staircases			
	1. Upper floors	03 No.	03 No.	MR
	2. Basements	N/A	N/A	N/A
	B. Width of staircase			
	1. Upper floors	2 mtr.	2 mtr. each	MR
	2. Basements	N/A	N/A	N/A
	C. Protection of exits			
	1. Fire check door	Required	Provided	MR*
	2. Pressurization	Required	Provided	MR*
	D. No. of continuous staircase to terrace	02 No	02 No	MR
	E. Width of corridor	2.4 mtr.	Provided	MR
	F. Door size	1 Mtr.	1 Mtr. each	MR
3.	Compartmentation			
	1) Fire check door	Required	Provided	MR
	2) Sealing of electrical shafts	Required	Provided	MR
	3) Fire rating of shaft door	Required	Provided	MR
	4) Water curtain	N/A	N/A	N/A
	5) Fire Dampers	N/A	N/A	N/A
4.	Smoke Management System			
	1) Basements	N/A	N/A	N/A
	2) Upper floors	12 ACPH	Provided	MR
5.	Fire Extinguishers			
	1) Total numbers	72 Nos.	90 Nos.	MR
	2) Types	ABC & CO2	ABC, CO2 & W.CO2	MR
	3) ISI marking	Required	Provided	MR
6.	First-Aid Hose Reel			
	1) Total number of each floor	03 No.	Provided	MR
	2) Length of hose reel hose	30 m	Provided	MR
	3) Nozzle diameter	5 mm	Provided	MR
7.	Automatic Fire Detection & Alarming System			
	1) Type of detectors	Required	Provided	MR

N/32


	2) Location of main panel	Gr. Floor	Provided	MR
	3) Location of repeater panel	Required	Provided	MR
	4) Alternate source of power	Required	Provided	MR
	5) Hooter's Location	Required	Provided	MR
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Provided	MR
10.	Automatic Sprinkler System			
	1) Basement	N/A	N/A	N/A
	2) Upper floors	Required	Provided	MR
	3) Sprinkler above false ceiling	Required	Provided	MR
11.	Internal Hydrants			
	1) Size of riser/down-comer	100 MM	100 MM	MR
	2) Number of hydrants per floor	03	03	MR
	3) Hose box each floor	03	03	MR
12.	Yard Hydrants			
	1) Total number of hydrants	04	04	MR
	2) Hose box	04	04	MR
13.	Pumping Arrangement			
	1) Ground level			
	a) Discharge of main pump	2850 LPM	Provided	MR
	b) Head of main pump	70 mtr.	70 mtr.	MR
	c) Number of main pump	02	02	MR
	d) Jockey pump out put (2 Nos.)	280 LPM	Provided	MR
	e) Jockey pump head	70 mtr.	70 mtr.	MR
	f) Stand by pump output	2850 LPM	2850 LPM	MR
	g) Stand by pump head	70 mtr.	70 mtr.	MR
	h) Auto starting/Manual stopping	Required	Provided	MR
	2) Terrace level			
	a) Discharge of pump	N/A	N/A	N/A
	b) Head of pump	N/A	N/A	N/A
	c) Power supply	N/A	N/A	N/A
	d) Auto starting of pump	N/A	N/A	N/A
14.	Captive Water Storage for Fire Fighting ( combined for all blocks)			
	1) Under ground tank capacity	1,00,000 ltr.	2,00,000 ltr.	MR
	a) Draw-off connection	Required	Provided	MR
	b) Fire service inlet	Required	Provided	MR
	c) Access to tank	Required	Provided	MR
	d) Over head tank capacity	20,000 Ltrs.	20,000 Ltr.	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
	a) Pressurization of lift shaft	Required	Provided	MR*
	b) Pressurization of lift lobby	Required	Provided	MR*
	c) Communication in lift car	Required	Provided	MR
	d) Fireman's switch	Required	Provided	MR
	e) Lift signage	Required	Provided	MR
17.	Stand by Power Supply	Required	Provided	MR
18.	Refuge Area	N/A	N/A	N/A

	Total area location	N/A	N/A	N/A
19.	Fire Control Room	Required	Provided	MR
	a) Detector system panel	Required	Provided	MR
	b) Flow switch panel	N/A	N/A	N/A
	c) PA system panel	Required	Provided	MR
	d) Battery backup	Required	Provided	MR
	e) Building floor plan	Required	Provided	MR
20.	Special Fire Protection System for Protection of special Risk, if any: Co2 & DCP			MR


The fire protection systems provided in the building were randomly tested, checked and found functional at the time of inspection. \* Further, an undertaking has been submitted by hospital authority vide letter no. 12-04/2025/RMLH/MS/112 dated 22.04.2025 placed on file regarding completion of compliance of installation of fire curtain at lift lobby, repairing of fire check door, pressurization system at staircase and lift lobby, clearing of 06 meter road for fire tender movement in one side within 03 month. Accordingly, as per direction and approval, we may accept the same and issue the conditional FSC.

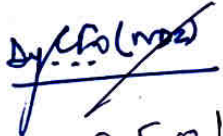

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules if agreed, we may renew the FSC issued vide letter No.F6/DFS/MS/Hospital/2015/NDZ/157 dated 03/02/15 with a condition as stated above, under rule 35(6) of the Delhi Fire Service rules 2010, is recommended for approval.

Signature of the Inspecting Officer

  
 Name: - Rajinder Atwal  
 Designation: - DO (CD)

Signature of the Inspecting Officer

  
 Name: - Ravinder Singh  
 Designation: - ADO (CC)

  
 C.F.O.  
  
 Director  
