

GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEAD QUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001

No. F6/DFS/MS/EH/2025/121

Dated: 08/04/2025

FIRE SAFETY CERTIFICATE

Certified that the M/s. Jubilant Food Works Ltd. (Domino's Pizza), located at Ground Floor, Shop No.- 6, 7 & 51 at D Mall, Paschim Vihar, District Centre, New Delhi 110063 in a building comprised of 03 tier Basement, Ground plus 12 upper floors. The FSC was earlier granted to said restaurant vide letter No. F6/DFS/MS/EH/WZ/2021/03 dated 07/01/2022. The said eating premises was re-inspected by the officer concerned of this department in the presence of Manager and observed that said eating house has deemed complied with the fire safety and fire prevention requirements in accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the eating premises is fit for occupancy Class-D (Assembly) "Eating House" at ground floor with effect from08/04/2025..... for a period of Three years in accordance with Rule 36 unless renewed under Rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under Rule 38 of the Delhi Fire Service Rules, 2010, printed overleaf.

Issued on 08/04/2025 at New Delhi by.

(Atul Garg)
 DIRECTOR
 Delhi Fire Service

Copy to:-

1. The Commissioner, MCD, Civic Centre New Delhi
2. The Joint Commissioner of Police, Licensing Unit, 1st Floor, Police Station Defence Colony, New Delhi. ID NO. 2025031703767 dated 17.03.2025.
3. The Owner/occupier, M/s. Jubilant Food Works Ltd. (Domino's Pizza), Ground Floor, Shop No.- 6, 7 & 51, Radisson Blu Hotel, Paschim Vihar, District Centre, New Delhi 110063.

Conditions for the validity of Fire Safety Certificate:

1. All the fire safety arrangements provided therein shall be maintained in good working conditions at all times. This FSC is valid for restaurant at ground floor only.
2. Any loss of life or property due to nonfunctional fire safety measures shall be at the responsibility of the management.
3. The trained fire fighting staff should be available round the clock.
4. The compliance with regards to electrical installation, structural stability, set back area, occupancy and any deviation in construction etc. shall be verified from authority concerned..
5. This fire safety certificate may not be treated in any case for regularization of unauthorized construction, if any.
6. The owner / occupier shall submit a declaration every year in form 'K' provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in
7. The means of escape shall be kept unobstructed / unlocked for unhindered evacuation in case of an emergency.
8. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in form 'J' [sub rule (I) of rule 37] along with a copy of this Certificate, six month prior to its expiry".
9. Any flammable material for interior decoration shall strictly be prohibited.

~ / 24

INSPECTION REPORT				
1	Name & Address of the Building	Jubilant Food Works Ltd. (Domino's Pizza) located at Ground Floor, Shop No. 6, 7 & 51, at D- Mall , District Centre, Paschim Vihar, New Delhi.		
2	Type of Occupancy	Group-D, Assembly Building		
3	Building Comprised of	Running at GF of a building comprised of 3 tier Basement, Ground floor plus 12 upper floors.		
4	Type of Case	Renewal		
5	Details of Previous NOC	F6/DFS/MS/EH/WZ/2021/03 dated 07/01/2022		
6	Fire Safety Directives Letter No	Nil		
7	Date of Inspection	27/03/2025		
8	Name of the Inspecting Officers	Sh. Ravinder Singh ADO/CC		
9	Name & Designation of Officers from the building side	Manager		
10	Year of construction	2020-21		
11	Applicant letter No.	ID NO. 2025031703767 dated 17.03.2025.		
S. No	Minimum standards on Fire Prevention and Fire Safety U/R 33	UBBL/NBC-IV Requirement	Provided at Site	Remarks MR/NMR
1	Access to Building.			
	• Road width	12 m	Provided	MR
	• Gate width	05 m	Provided	MR
	• Width of internal road	06 m	Provided	MR
2	Number, width, type & arrangement of exits.			
	a) Number of Staircase			
	➤ Upper floors	-N/A-	Running at GF only	-N/A-
	➤ Basement	-N/A-	-N/A-	-N/A-
	b) Width of Staircase			
	➤ Upper floors	-N/A-	Running at GF only	-N/A-
	➤ Basement	-N/A-	-N/A-	-N/A-
	c) Protection of exits			
	➤ Fire check door	Required	Provided	MR
	➤ Pressurization	-N/A-	-N/A-	-N/A-
	d) No. of continuous staircase to terrace	-N/A-	-N/A-	-N/A-
	e) Width of corridor	-N/A-	-N/A-	-N/A-
	f) Door size	02 x 1.5 m	2.0 , 1.5 m	MR
3	Compartmentation.			
	• Fire check door.	-N/A-	-N/A-	-N/A-
	• Sealing of electrical shafts.	-N/A-	-N/A-	-N/A-
	• Fire rating of shaft door.	-N/A-	-N/A-	-N/A-
	• Water curtain	-N/A-	-N/A-	-N/A-
	• Fire dampers.	-N/A-	-N/A-	-N/A-
4.	Smoke Management system.			
	• Basement	-N/A-	-N/A-	-N/A-

N/25

	<ul style="list-style-type: none"> Upper floors 	12 ACPH	Provided	MR
5.	Fire Extinguishers.			
	<ul style="list-style-type: none"> Total numbers 	06	06	MR
	<ul style="list-style-type: none"> Types 	ABC & CO ₂	ABC- 03 & CO ₂ -03	MR
	<ul style="list-style-type: none"> ISI Marking 	ISI marked	Provided	MR
6.	First Aid Hose Reels.	Common with the building		
	<ul style="list-style-type: none"> Total numbers on each floor 	Required	Provided by Hotel	MR
	<ul style="list-style-type: none"> Length of hose-reel hose. 	30 m	Provided by Hotel	MR
	<ul style="list-style-type: none"> Nozzle Diameter 	05 mm	Provided by Hotel	MR
7	Automatic fire detection & alarming system.	Common with the building		
	<ul style="list-style-type: none"> Type of detectors 	Smoke & Heat	Provided	MR
	<ul style="list-style-type: none"> Location of Main Panel 	Ground floor	Provided by Hotel	MR
	<ul style="list-style-type: none"> Location of Repeater Panel 	All floor	Provided	MR
	<ul style="list-style-type: none"> Alternate source of power 	Required	USB + DG set	MR
	<ul style="list-style-type: none"> Hooter's location 	All floor	Provided	MR
8.	MOEFA	Required	Provided	MR
9.	Public Address System	Required	Provided	MR
10.	Automatic Sprinkler System	Common with the building		
	<ul style="list-style-type: none"> Basement. 	-N/A-	-N/A-	-N/A-
	<ul style="list-style-type: none"> Upper floors 	Required	Provided	MR
	<ul style="list-style-type: none"> Sprinkler above false ceiling 	Required	Provided	MR
11.	Internal Hydrants.	Common with the building		
	<ul style="list-style-type: none"> Size of Riser / Down-comer 	150 mm	Provided by Hotel	MR
	<ul style="list-style-type: none"> Number of Hydrant per floor 	Required	Provided by Hotel	MR
	<ul style="list-style-type: none"> Hose box. 	Required	Provided by Hotel	MR
12.	Yard Hydrants.	Common with the building		
	<ul style="list-style-type: none"> Total number of hydrants. 	-N/A-	-N/A-	-N/A-
	<ul style="list-style-type: none"> Hose box. 	-N/A-	-N/A-	-N/A-
13.	Pumping arrangements.	Common with the building		
	<ul style="list-style-type: none"> Ground Level 			
	Discharge of main pump.	2850 LPM	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Head of main pump. 	80 m	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Number of main pumps. 	2	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Jockey Pump output. 	2 × 180 LPM	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Jockey Pump head. 	2 × 180 LPM	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Standby Pump output. 	2850 LPM	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Standby Pump head. 	80 m	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Auto Starting/Manual stopping. 	Required	Provided by Hotel	MR
	<ul style="list-style-type: none"> ➤ Pump house access. 	Required	Provided by Hotel	MR
	<ul style="list-style-type: none"> Terrace Level 	Common with the building		

N/26

	<ul style="list-style-type: none"> ➤ Discharge of pump. ➤ Head of pump. ➤ Power supply. ➤ Auto starting of pump. 	900 LPM	Provided by Hotel	MR
		80 m	Provided by Hotel	MR
		Required	Provided by Hotel	MR
		Required	Provided by Hotel	MR
14.	Captive water storage for firefighting.	Common with the building		
	<ul style="list-style-type: none"> • Underground tank capacity. ➤ Draw-off connection. ➤ Fire Service Inlet. ➤ Access to tank. • Overhead tank capacity. 	2,00,000 ltrs	Provided by Hotel	MR
		Required	Provided by Hotel	MR
		Required	Provided by Hotel	MR
		Required	Provided by Hotel	MR
		20,000 ltrs	Provided by Hotel	MR
15.	Exit Signage.	Required	Provided	MR
16.	Provision of Lifts.			
	<ul style="list-style-type: none"> • Pressurization of lift shaft. • Pressurization of lift lobby. • Communication in lift car. • Fireman's switch. • Lift signage. 	-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
17	Standby Power Supply	Required	UPS + DG set	MR
18.	Refuge Area			
	<ul style="list-style-type: none"> • Total area • Location 	-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
19.	Fire Control Room.	Common with the building		
	<ul style="list-style-type: none"> • Detector System Panel. • Flow Switch Panel. • PA system Panel. • Battery backup • Building floor plan 	Required	Provided	MR
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
		-N/A-	-N/A-	-N/A-
20.	Special Fire Protection System for the Protection of special Risk, if any.	-N/A-	-N/A-	-N/A-

The fire protection systems provided in the said premises were randomly tested, checked and found functional at the time of inspection.

In view of the deemed compliance of the minimum standards of fire prevention and fire safety measures as required under the rules, if agreed, we may renew the FSC issued vide letter no. F6/DFS/MS/EH/WZ/2021/03 dated 07/01/2022, under rule 35(6) of the Delhi Fire Service Rules 2010. Accordingly, DFA is put up for kind perusal and signature please.


Signature of the Inspecting Officer


 Name: - Sh. Ravinder Singh
 Designation: - ADO (CC)

582/2024
 3/14/2025



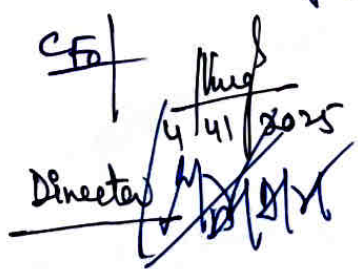

CFI

 Director
 4/11/2025



PTD