



GOVERNMENT OF NATIONAL CAPITAL TERRITORY OF DELHI
HEADQUARTERS: DELHI FIRE SERVICE: NEW DELHI-110001




No. F.6/DFS/MS/EH/2025/SZ/ 353

Dated: 16/10/2025

FIRE SAFETY CERTIFICATE

Certified that the premise of M/s Nathu's Sweets situated at 19, Ground Floor, Community Centre, New Friends Colony, New Delhi-110025, running at ground floor of a building comprised of basement, ground, mezzanine plus two upper floors, was issued Fire Safety Certificate by this department vide letter No. F.6/DFS/MS/EH/2022/SZ/23 dated 02/02/2022. The said restaurant was re-inspected by the officer concerned of this department on 09/10/2025 in the presence of Mr. Vipin Gupta (Owner) and found that said premises have complied with the fire prevention and fire safety requirements in accordance with rule 33 of Delhi Fire Service Rules, 2010 and that the said premise is fit for occupancy class "Assembly Group D" (Restaurant at ground floor only) with effect from 16/10/2025 for a period of three years in accordance with rule 36 unless renewed under rule 37 or sooner cancelled under Rule 40 and subject to compliance of the conditions under rule 38 of the Delhi Fire Service Rules, 2010.

Issued on 16/10/2025 at New Delhi by


(A. K. Malik)
Dy. Chief Fire Officer (SZ)
Delhi Fire Service
01/10/25

Copy to: -

1. The Dy. Health Officer, MCD, Public Health Department, Central Zone, Jal Vihar, Lajpat Nagar, New Delhi-110024 (w.r.t. Online Id. No. 2025092613756 dated 26/09/2025)
2. Sh. Vipin Gupta, M/s Nathu's Sweets situated at 19, Ground Floor, Community Centre, New Friends Colony, New Delhi-110025

Conditions for the validity of Fire Safety Certificate:

1. All the means of escape/entry/exit shall be kept free from any obstruction.
2. All the fire safety arrangement provided there in shall be maintained in good working conditions at all time as seen during inspection. Any loss of life property due to non-functional fire safety measures shall be at the responsibility of the management.
3. All the staff members must know the correct method of operation of fire-fighting system.
4. Basement shall be used as per Building Bye-laws.
5. This fire safety certificate may not in any way be treated as regularization (Clause 2.8 of UBBL-2016) of unauthorized construction or alteration (Clause 1.4.3 of UBBL-2016), if any.
6. The owner/occupier shall apply for renewal of this Fire Safety Certificate to the Director in Form 'J' [sub rule (1) of rule 37] along with a copy of this certificate, prior to its expiry.
7. The owner/occupier shall submit a declaration every year in form "K" provided in the first schedule of Delhi Fire Service Rules 2010. The form is available on www.dfs.delhigovt.nic.in

N-17

INSPECTION REPORT

| | | | | |
|--------|---|---|-----------------------|----------------|
| 1. | Name & address of the building | Nathu's Sweets situated at 19, Ground Floor, Community Centre, New Friends Colony, New Delhi-110025 | | |
| 2. | Type of Occupancy | Assembly, Group D (Eating House) | | |
| 3. | Building Comprised of | Basement, Ground + Mezzanine + 02 upper floors but Restaurant is running at GF only | | |
| 4. | Type of Case | Renewal | | |
| 5. | Details of previous NOC No. | F.6/DFS/MS/EH/2022/SZ/23 Dt 02/02/2022 | | |
| 6. | Fire Safety directives Letter No. | Nil | | |
| 7. | Date of inspection | 09/10/2025 | | |
| 8. | Name of the Inspecting Officer | ADO (JKP) | | |
| 9. | Name and designation of Officer from the building side | Mr. Vipin Gupta (Owner) | | |
| 10. | Year of Construction | 1988 | | |
| 11. | Applicant's letter No./Online Appl | No. 2025092613756 dated 26/09/2025 | | |
| S. No. | Minimum standards on fire prevention and fire safety U/R 33 | Old NOC Requirement | Provided at site | Remarks MR/NMR |
| 1. | Access of building | | | |
| | • Road width | 6.0 mtr | Provided | MR |
| | • Gate width | N/A | N/A | N/A |
| | • Width of internal road | N/A | N/A | N/A |
| 2. | Number, width, Type & Arrangements of exits | | | |
| | a. Number of staircases | | | |
| | • Upper floors | N/A | N/A | N/A |
| | • Basements | N/A | N/A | N/A |
| | b. Width of staircases | | | |
| | • Upper floors | N/A | N/A | N/A |
| | • Basements | N/A | N/A | N/A |
| | c. Protection of exits | | | |
| | • Fire check door | N/A | N/A | N/A |
| | • Pressurization | N/A | N/A | N/A |
| | d. No of continuous staircase to terrace | 01 | 01 | MR |
| | e. Width of Corridor | N/A | N/A | N/A |
| | f. Door Size | 2m | 2m & 1.3m | MR |
| 3. | Compartmentation | | | |
| | • Fire check door | N/A | N/A | N/A |
| | • Sealing of electrical shafts | N/A | N/A | N/A |
| | • Fire Rating of shaft door | N/A | N/A | N/A |
| | • Water Curtain | N/A | N/A | N/A |
| | • Fire Dampers | N/A | N/A | N/A |
| 4. | Smoke Managements System | | | |
| | • Basements | N/A | N/A | N/A |
| | • Upper floors | 12 ACPH | Provided in Kitchen | MR |
| 5. | Fire Extinguishers | | | |
| | • Total numbers | 10 Nos | 10 Nos | MR |
| | • Types | ABC/CO ₂ /WCO ₂ | ABC & CO ₂ | MR |
| | • ISI marking | Required | Provided | MR |
| 6. | First-Aid Hose Reels | | | |
| | • Total numbers on each floor | 01 | 01 | MR |
| | • Length of hose reel hose | 30m | 30m | MR |
| | • Nozzle diameter | 5mm | 5mm | MR |

SP

| | | | | |
|-----|---|------------|----------|-----|
| 7. | Automatic fire detection and alarming system. | | | |
| | • Type of detector | N/A | N/A | N/A |
| | • Location of Main Panel | N/A | N/A | N/A |
| | • Location of Repeater Panel | N/A | N/A | N/A |
| | • Alternate source of power | N/A | N/A | N/A |
| | • Hooters' Location | N/A | N/A | N/A |
| 8. | MOEFA | Required | Provided | MR |
| 9. | Public Address System | N/A | N/A | N/A |
| 10. | Automatic Sprinkler System | | | |
| | • Basements | Required | Provided | MR |
| | • Upper Floor | N/A | N/A | N/A |
| | • Sprinkler above false ceiling | N/A | N/A | N/A |
| 11. | Internal Hydrants | | | |
| | • Size of riser/down- comer | Required | 150 mm | MR |
| | • Number of hydrants per floor | Required | 01 | MR |
| | • Hose Box | Required | 01 | MR |
| 12. | Yard Hydrants | | | |
| | • Total number of hydrants | N/A | N/A | N/A |
| | • Hose Box | N/A | N/A | N/A |
| 13. | Pumping Arrangements | | | |
| | • Ground Level | | | |
| | ➤ Discharge of main pump | N/A | N/A | N/A |
| | ➤ Head of main pump | N/A | N/A | N/A |
| | ➤ Number of main pumps | N/A | N/A | N/A |
| | ➤ Jockey pump out put | N/A | N/A | N/A |
| | ➤ Jockey pump head | N/A | N/A | N/A |
| | ➤ Standby Pump out put | N/A | N/A | N/A |
| | ➤ Standby Pump Head | N/A | N/A | N/A |
| | ➤ Auto Staring/Manual stopping | N/A | N/A | N/A |
| | ➤ Pump House Access | N/A | N/A | N/A |
| | • Terrace level | | | |
| | ➤ Discharge of pump | 900 LPM | Provided | MR |
| | ➤ Head of the pump | 35 mtr | Provided | MR |
| | ➤ Power supply | Required | Provided | MR |
| | ➤ Auto starting of pump | Required | Provided | MR |
| 14. | Captive water Storage for fire fighting | | | |
| | • Underground tank capacity | N/A | N/A | N/A |
| | ➤ Draw of connection | N/A | N/A | N/A |
| | ➤ Fire service inlet | N/A | N/A | N/A |
| | ➤ Access to tank | N/A | N/A | N/A |
| | • Overhead Tank capacity | 15,000 ltr | Provided | MR |
| 15 | Exit Signage | Required | Provided | MR |
| 16. | Provision of Lifts | | | |
| | ➤ Pressurization of Lift Shaft | N/A | N/A | N/A |
| | ➤ Pressurization of lift lobby | N/A | N/A | N/A |
| | ➤ Communication in lift Car | N/A | N/A | N/A |
| | ➤ Fireman's Grounding Switch | N/A | N/A | N/A |
| | ➤ Lift Signage | N/A | N/A | N/A |
| 17. | Standby Power Supply | Required | Provided | MR |
| 18. | Refuge Area | | | |
| | ➤ Total area | N/A | N/A | N/A |
| | ➤ Location | N/A | N/A | N/A |


N-19


| | | | | |
|-----|--|---|-----|-----|
| 19. | Fire Control Room | | | |
| | ➤ Detector system panel | N/A | N/A | N/A |
| | ➤ Flow Switch Panel | N/A | N/A | N/A |
| | ➤ PA System Panel | N/A | N/A | N/A |
| | ➤ Battery backup | N/A | N/A | N/A |
| | ➤ Building Floor Plans | N/A | N/A | N/A |
| 20. | Special Fire Protection Systems for Protection of Special Risks, if any; | CO ₂ type fire extinguisher provided near electrical panel | | MR |

The fire protection systems provided in the building were checked, tested at random and found functional at the time of inspection. The shortcomings issued from fire safety point of view vide letter No. F6/DFS/MS/EH/SZ/2025/314 dated 22/07/2025 found complied.

Keeping in view of the deemed compliance of the minimum standards on fire prevention and fire safety as required under the rules, the fire safety certificate issued vide letter No. F.6/DFS/MS/EH/2022/SZ/23 dated 02/02/2022, **renewal under rule 37 of the Delhi Fire Service Rules, 2010 is recommended.**

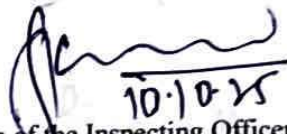

Accordingly, DFA is put up for approval and signature please.


10.10.25
Signature of the Inspecting Officer
Name: Santosh Kumar
Designation: ADO (JKP)



DO (SD)

13/10/25

Dy. CS (SZ)


14/10/25
A.K. MALIK
Principal Director

Dy. CS to 

14/10/25

Dy. CS (SZ)

AOO (SKP)

14/10/25
A.K. MALIK

16/06/24

P.T.O